

IDEA 2828  
Copy 3  
2 December 1965

SUBJECT: Monthly UR Reports - October

REF: PROJECT DIRECTIVE 45-9

- 10-1. BH 185R-11B, INDICATOR EGT, SER. NBR. 304, FLIGHT TIME, UNKN ACFT 352. STRUCK AT MAXIMUM POSITION, REPLACED WITH SERVICABLE PART, SER. NBR. 374A. NEGATIVE
- 10-2. SP-MS-28041-1, INDICATOR TURN AND SLIP, SER. NBR. 58-7333, FLIGHT TIME UNKN, ACFT 359. TURN PADDLE STICKS, REPLACED WITH SERVICABLE PART SER. NBR. 56-2895. NEGATIVE
- 10-3. SP-L1-4D, STRUT, M.L.G., SER. NBR. 209, FLIGHT TIME UNKN, ACFT 359, WENT FLAT DURING TOW, REPLACED WITH SERVICABLE PART, SER. NBR. 206. NEGATIVE
- 10-4. SP H 222. TRANSMITTER FUEL COUNT, SER. NBR. 376453M1, FLIGHT TIME 790.8 ACFT 352, READS TO LOW, REPLACED WITH SERVICABLE PART, SER. NBR. 375703. NEGATIVE
- 10-5. SP 60-4962, INDICATOR AIR SPEED, SER. NBR. 19615, FLIGHT TIME UNKN, ACFT. 352. RELIABILITY QUESTIONABLE, NO CORRECTION CARD WAS IN A/C. REPLACED WITH SERVICABLE PART, SER. NBR. 19206. NEGATIVE
- 10-6. 1507, TRANSISTOR CHECKER, MOD. 219B, DEFECTIVE BETA READOUT. REPAIRABLE ITEM RETURNED TO DEPOT. NEGATIVE
- 10-7. 04615, MX 1489/ARC-34, CHANNELS CONTINUOUSLY, REPAIRABLE ITEM RETURNED TO DEPOT. NEGATIVE
- 10-8. AF-63-30, COLLINS 618T-3 TRANSCEIVER, RECEIVED WITH FINAL NEEDING ALIGNMENT REPAIRABLE ITEM RETURNED TO DEPOT. NEGATIVE
- 10-9. C-528-0113-00, RF TRANSLATOR, NO POWER OUTPUT ABOVE 25 MCS. REPAIRABLE ITEM RETURNED TO DEPOT. NEGATIVE
- 10-10. AM-868/ARC-34, LOW POWER OUTPUT. REPLACED V102.